Approved Fo	or Release 2000/08	/26 : CIA-RDP/1	B00500R00010	0050013-7
	5	ECRET	The state of the s	The gradient of the second of
	Service &	politica i de la Martida d'Artida de	(100, 100, 100, 100, 100, 100, 100, 100,	ere agent tipes i en en la se mai se alla fra modelle del se successor provinció su describer en el se del se En el presenta del se en el se se el comparte del se en el se
g general states of the constant of	Filter and I Marie . It will be deed him and	e versione de la companie de la comp La companie de la companie de		A TOWN TOWN AND MAN STREET, AND A STREET, AN
- 14월) 1	· · · · · · · · · · · · · · · · · · ·	er er		
1864 1	$A \sim A$	•		
	400			
5040000 m	The V	ĺ		A CONTRACTOR OF THE PARTY OF TH
idera t	:	Just Sur		
is in the second of the second	4			<b>1</b>
1475426		OSA 1-15	m mader	
Film 2	/2	104°	100	্বিক প্রায়ার প্রতি ১ বিশ্ব বিশ্ব বিশ্ব বিশ্ব
\$40 -	25>	X1A //	The same	· 94 - 1988
SECRET	210839Z CITE		+	
PR IOR IT	25V1	^		
OXCART	25X1	A	•	
1A		<u> </u>	. n.	

- 1. 129 FLEW TODAY AND LOST ITS LOWER LEFT FILLET STARTING AT THE REAR OF THE MAIN GEAR WELL. THE LOSS WAS COMPLETE TO INCLUDE PORTIONS OF STRUCTURE ALONG THE FUSELAGE AND AT THE TAIL CONE. THIS INCIDENT OCCURRED SHORTLY AFTER ENTERING CLIMB AT APPROXIMATELY 400 KEAS, THE PILOT EXPERIENCING A PRONOUNCED YAW. HE IMMEDIATELY ABORTED THE MISSION AND RETURNED DUMPING FUEL ENROUTE.
- 2. PRELIMINARY INVESTIGATION HAS NOT PINPOINTED A START FAILURE POINT. WHEN THE FILLET CAME OFF IT APPARENTLY FOLDED UNDER THE REAR PORTION OF THE FUSELAGE AND DID MINOR SKIN PUNCTURE DAMAGE TO THE RIGHT SIDE. IN ADDITION NUMEROUS WIRES WITHIN THE MAIN WIRE BUNDLE WERE EITHER CUT, FRAYED OR SCRAPED. SOME SMALL RIVETS WERE PULLED FROM NBR 6 FUEL TANK ALLOWING FUEL TO SEEP OUT.
  - 3. WE ARE NOW IN THE PROCESS OF ACCESSING THE DAMAGE, CHECKING

SECRET SECRET

## Approved For Release 2000/08/26 : CIA-RDP71B00560R000100050013-7

25X1A

[N75426

SECHET

PAGE 2

SPARE PANEL AND FILLET AVAILABILITY AND ATTEMPTING TO IDENTIFY THOSE SYSTEMS AFFECTED BY THE DAMAGED WIRING. WE ARE ALSO INSPECTING THE OTHER TWO AIRCRAFT IN THIS SAME AREA OF FAILURE FOR CLUES AS TO POSSIBLE CAUSE.

4. IT IS TOO EARLY TO GIVE AN ACCURATE ESTIMATE OF REPAIR TIME.

I HOPE TO HAVE THIS INFORMATION LATE TONIGHT OR TOMORROW. DETAILED

DAMAGE REPORT TO FOLLOW. WILL KEEP YOU INFORMED AS WE PROGRESS.

S E C R E T TOR: 210901Z NOV 67

SECRET